


Maglia di giunzione CW


CW Connecting link

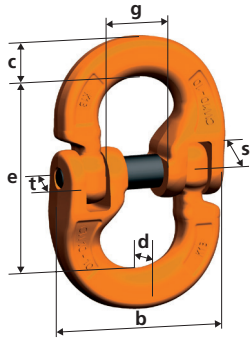

Tipo Type	Portata WLL Kg	Dimensioni Dimensions							Peso Weight Kg
		b mm	c mm	d mm	e mm	g mm	s mm	t mm	
CW 5	1000	34	7	7	36	13	9	12	0,05
CW 6	1400	39	8	8	44	14	11	13	0,06
CW 7	1900	46	10	9	51	17	13	16	0,12
CW 8	2500	55	12	10	62	18	14	20	0,18
CW 10	4000	64	15	13	72	24	18	22	0,42
CW 13	6700	79	20	17	88	28	22	26	0,84
CW 16	10000	105	24	24	103	33	29	35	1,40
CW 19-20	16000	123	32	25	115	44	35	45	2,40
CW 22	19000	148	36	26	161	52	39	46	4,15
CW 26	26500	175	40	30	190	60	46	49	6,70
CW 32	40000	216	47	35	206	80	56	63	11,20

Maglia di giunzione inamovibile CLW


CLW Unremovable connecting link

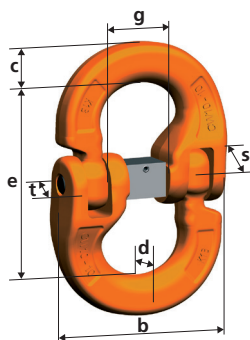

Tipo Type	Portata WLL Kg	Dimensioni Dimensions							Peso Weight Kg
		b mm	c mm	d mm	e mm	g mm	s mm	t mm	
CLW 7	1900	47	10	9	51	17	13	14	0,12
CLW 10	4000	64	15	13	72	24	18	22	0,42
CLW 13	6700	79	20	17	88	28	22	26	0,84
CLW 16	10000	106	21	21	103	33	29	31	1,40
CLW 19/20	16000	123	30	24	115	42	35	37	2,40
CLW 22	19000	148	34	25	161	51	39	42	4,15
CLW 26	26500	175	40	30	190	60	46	49	6,70
CLW 32	40000	216	47	35	206	80	56	63	11,20

Maglia di giunzione per brache di poliestere CARW

CARW Webbing slings connecting link

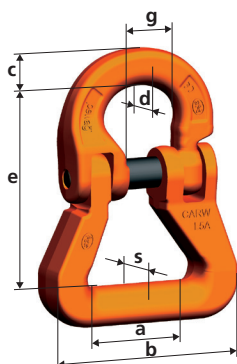

Tipo Type	Portata WLL Kg	Dimensioni Dimensions							Peso Weight Kg
		a mm	b mm	c mm	d mm	e mm	g mm	s mm	
CARW 8	2500	29	68	12	10	66	18	18	0,4
CARW 10	4000	40	82	15	13	81	24	21	0,5
CARW 13	6700	44	100	20	17	104	28	28	1,2
CARW 16	10000	47	110	21	21	113	33	40	2
CARW 22	19000	110	215	34	25	190	48	58	6,5